

# Flying Pig Systems

## Wholehog II MIDI Input Hardware implementation error & modification

Serial numbers affected: ALL CONSOLES UPTO 05160

There exists a hardware error in the Wholehog II MIDI Input implementation. Referring to Figure 1 it can be seen that a resistor, R8, exists across the MIDI input signal lines. This resistor should not be there and may cause MIDI receive data errors or no reception at all.

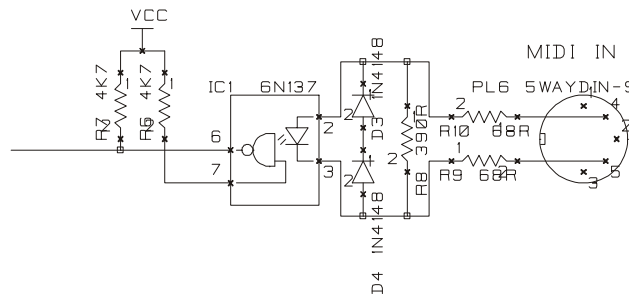


Figure 1

To ensure correct operation this resistor must be removed. Please consult Figure 2 to locate its position on the back panel (I/O) pcb. It is recommended that the resistor simply be cut out without removing the circuit board taking care to ensure that the console is disconnected from the mains supply. It would also be most helpful if you could notify me via email (below) of the serial numbers of any consoles thus modified. Thanks.

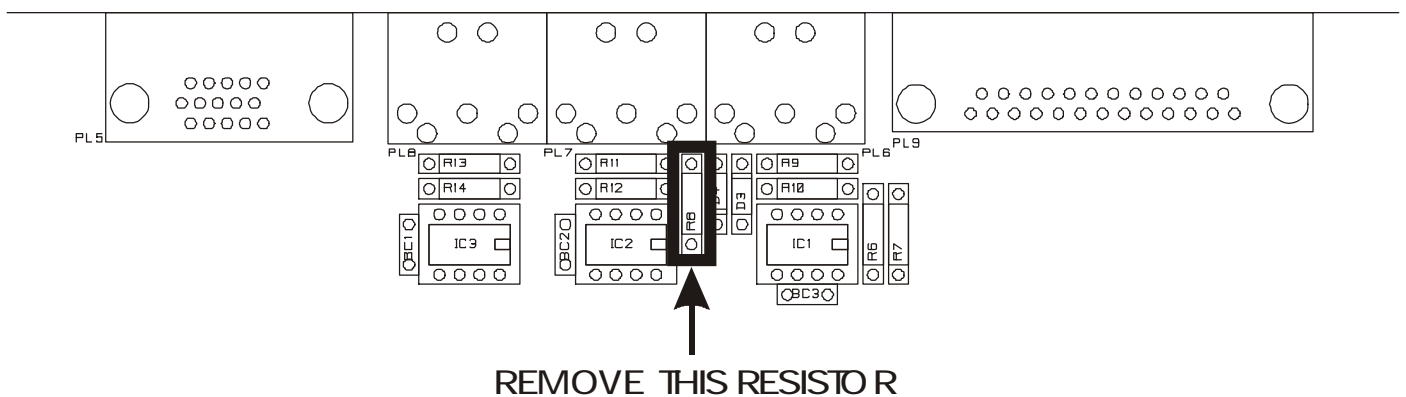


Figure 2

Consoles with serial numbers 05161 onwards have been factory modified. Please accept my apologies for this error and any problems that it may have caused.

NEA 13<sup>th</sup> April 1999

53, Northfield Road, London W13 9SY

Tel: (44)-181-579-3788 Fax: (44)-181-579-8469

Reg. No.: UK 2648483

Email: beaky@flyingpig.com Internet: <http://www.flyingpig.com>

VAT No.: 538 9132 23