



Service Bulletin

Subject: Lamp Adjust Spring

Product Line: Studio Command

Date: 10/06/06

There has been a possible problem identified affecting the Studio Command lamp adjust assembly. This problem could affect all models of the Studio Command fixtures;

- Studio Command H
- Studio Command 700
- Studio Command 1200

The Studio Command lamp adjust assembly utilizes three (3) springs for adjustment between the "Outer Access Plate" and the "Lamp Socket Plate."

A limited number of fixtures were manufactured using adjustment springs that were too short, causing the optimizing plate to be in the wrong location, and making it impossible to properly optimize the lamp output.

The correct spring has nine (9) winds to its coil.



The wrong spring has four (4) winds to its coil.

Lamp Adjust Assembly


Lamp Socket Plate

Nine (9) Wind Spring

Outer Access Plate

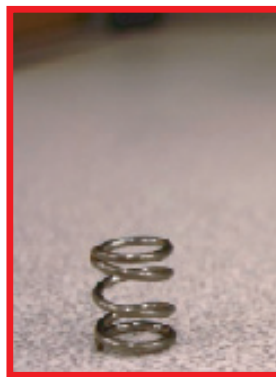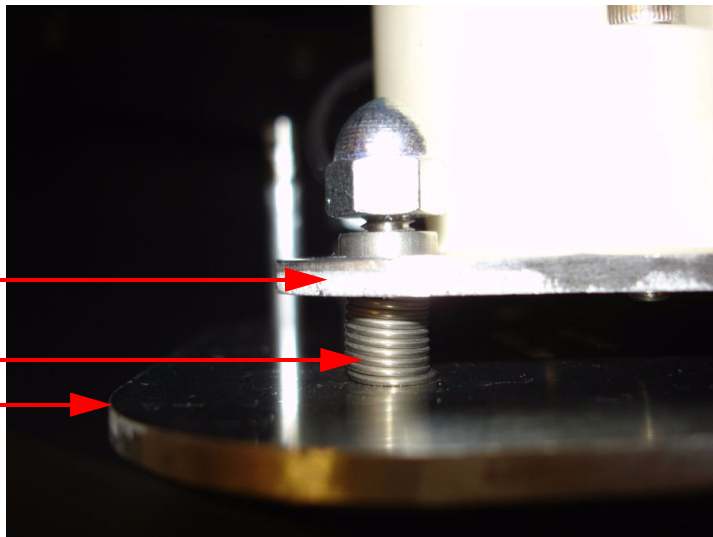

Wrong
(Four wind Coil)

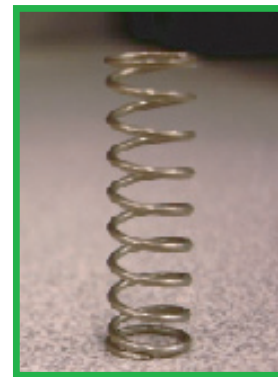

Correct
(Nine wind Coil)